



National Inspection Services

Report: 340258
08/19/2026

Custom Truck & Equipment (Rod Dickason)
7701 Independence Ave, Kansas City, MO 64125 USA
(816) 241-4888

VIN: 3HSCUAPR3AN169179
PO #: 0000

2010 INTERNATIONAL PROSTAR LF627

SPECIFICATIONS

MILEAGE	663,156 / 96,522 (ECM)
ENGINE HOURS	3,974
ENGINE	CUMMINS ISX 15 14.9L 450 HP
ENG BRAKE	YES
ENG SERIAL	79360547
FUEL / TANKS	DIESEL - 2 ALUM 200 GAL TOTAL
EXHAUST	SINGLE
TRANSMISSION	FULLER FRO-16210C 10 SPD MANUAL
DRIVE OPTS	POWER STEERING, OVERDRIVE, CRUISE
REAR END	SPICER 3.7
AXLE TYPE	TRI - F 12,350 LB / R 40,000 LB
GVWR	52,350
FRAME	STEEL
SUSPENSION	AIR RIDE
WHEELBASE	175"
TIRE SIZE	F 315/80R22.5 / R 11R 22.5
WHEELS	F ALUMINUM / R ALUMINUM
AIR COND	YES
INTERIOR COLOR	GREY
RADIO	AM/FM / CD, OPERATIONAL
HIGH BACK SEATS	DUAL
PASSENGER SEAT	AIR RIDE
EXTERIOR COLOR	WHITE
BUMPER	CHROME
DUMP TYPE	STEEL



NOTES / DESCRIPTION

UNIT RUNS/ COULD NOT MOVE DUE TO GETTING STUCK/ CLUTCH SLIPS

BRAKES

LEFT FRONT	RIGHT FRONT
COVERED	COVERED
LEFT REAR 1	RIGHT REAR 1
28	28
LEFT REAR 2	RIGHT REAR 2
28	28
LEFT REAR 3	RIGHT REAR 3
28	28

TIRES & WHEELS

LEFT FRONT		RIGHT FRONT	
19 / 32 TOYO ALUMINUM		21 / 32 TOYO ALUMINUM	
LEFT OUTER 1	LEFT INNER 1	RIGHT INNER 1	RIGHT OUTER 1
15 / 32 TOYO ALUMINUM	- - -	- - -	13 / 32 TOYO ALUMINUM
LEFT OUTER 2	LEFT INNER 2	RIGHT INNER 2	RIGHT OUTER 2
11 / 32 - ALUMINUM	12 / 32 - ALUMINUM	14 / 32 BRIDGESTONE ALUMINUM	10 / 32 BRIDGESTONE ALUMINUM
LEFT OUTER 3	LEFT INNER 3	RIGHT INNER 3	RIGHT OUTER 3
23 / 32 CONTINENTAL ALUMINUM	22 / 32 CONTINENTAL ALUMINUM	20 / 32 CONTINENTAL ALUMINUM	21 / 32 CONTINENTAL ALUMINUM
FRONT TIRES: 315/80R22.5		REAR TIRES: 11R 22.5	

ADDITIONAL TIRE DETAIL

RLO 2, RLI 2 - THUNDER TIRES/ RRO 2 - FLAT

GENERAL OBSERVATIONS

OIL MILKY?	NO	LIGHTS WORK?	YES - ALL
OIL LEAKS?	YES	WIPERS WORK?	YES

WATER LEAKS?	NO	GAUGES WORK?	YES - ALL
OIL IN COOLANT?	NO	AIR HORN WORKS?	YES
CLUTCH PLAY?	NEEDS ATTENTION	CITY HORN WORKS?	YES
STARTS?	YES		
DRIVES	SEE NOTES	DIESEL PARTICULATE FILTER	PASS


ADDITIONAL OBSERVATIONS

CLUTCH PLATE/ SLIPPING/ COULD NOT GET VIDEO OF UNIT MOVING - SNAP TEST - OK. OIL LEAK AT D/S OIL PAN GASKET AREA. ODOMETER AND ECM MILEAGE DON'T MATCH. VIN INFORMATION ON ECM REPORT DOESN'T SHOW BUT HOURS ARE MATCH DASH

WEAR & TEAR DETAIL

DIAGNOSTICS	4 ACTIVE AND 11 INACTIVE FAULT CODES FOUND (SEE ECM REPORT)
BUMPER	DENTED ON P/S
PAINT	SCRATCHED AT P/S MIRROR COVER & FENDERS. FLAKING & SURFACE RUST AT POWERTRAIN, UNDERCARRIAGE & DUMP BED
HOOD MIRROR	P/S MISING GLASS
DASH	D/S COVER MISSING
HEADLINER	STAINED FABRIC
SEATS	UPHOLSTERY IS WORN, RIPPED AND STAINED
WINDSHIELD	CHIPPED GLASS
INTERIOR	DIRTY, NEEDS CLEANED

REPORT PHOTOS

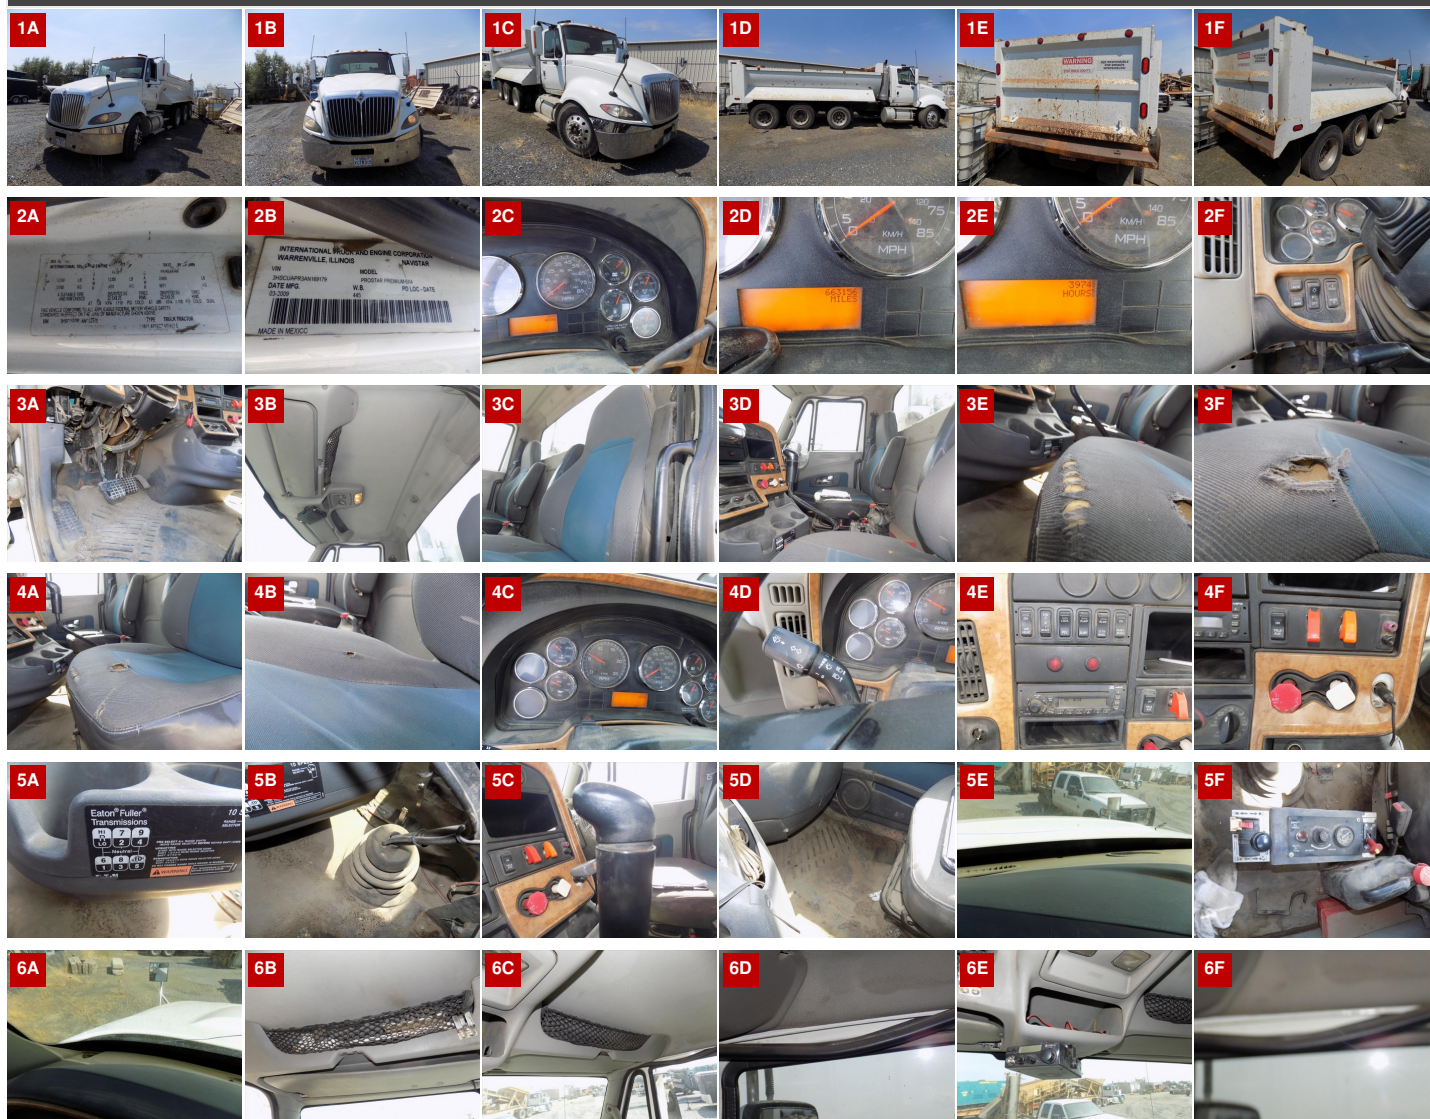





REPORT DOCUMENTS

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© National Inspection Services
239 W. Mill St. Liberty, MO 64068
www.nationalinspect.com